



**NUMBER:** 02-005-05

**GROUP:** Suspension

**DATE:** December 14, 2005

*This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of DaimlerChrysler Corporation.*

**SUBJECT:**

Squeak-Like Sound From Rear Spring Isolator

**OVERVIEW:**

This bulletin involves the replacement of the rear spring isolators (four in total).

**MODELS:**

2005 - 2006	(WK / WH)	Grand Cherokee
2006	(XK)	Commander

**NOTE:** This bulletin applies to domestic built (JNAP) vehicles built prior to December 01, 2005 (MDH 1201XX), and to internationally built (GRAZ) vehicles built prior to January 01, 2006 (MDH 0101XX).

**SYMPTOM/CONDITION:**

The customer may experience a squeak-like sound coming from the vehicle rear suspension. The squeak will occur most often when the rear of the body and the rear suspension move relative to each other. The squeak condition may be caused by the type of material used in the rear spring isolator.

**DIAGNOSIS:**

With the vehicle parked and on a flat surface, rock (jounce) the rear of the vehicle up and down. If the squeak-like sound occurs at one or more of the four rear spring isolators, then perform the Repair Procedure.

**PARTS REQUIRED:**

Qty.	Part No.	Description
4	52089341AE	Isolator, Rear Spring

**REPAIR PROCEDURE:**

1. Replace the four (4) rear spring isolators. Refer to the detailed repair procedures in TechCONNECT - Service Info Tab / 2 - Suspension / Rear / Spring / Removal and Installation.

**POLICY:**

Reimbursable within the provisions of the warranty.

**TIME ALLOWANCE:**

<b>Labor Operation No:</b>	<b>Description</b>	<b>Amount</b>
02-30-11-90	Isolator, Rear Spring - Replace All (4)	0.7 Hrs.

**FAILURE CODE:**

ZZ	Service Action
----	----------------