

June 11, 2010

**TO:** ALL DODGE AND JEEP DEALERS

**FROM:** TECHNICAL SERVICE OPERATIONS

**SUBJECT:** RAPID RESPONSE TRANSMITTAL #10-021 REV. A  
MIL Illumination Due To Cooling System Thermostat

**INVOLVED VEHICLES:**

2010 (WK) Grand Cherokee  
2010 (XK) Commander  
2010 (KA) Nitro  
2010 (KK) Liberty

**THIS IS A REVISION TO RAPID RESPONSE TRANSMITTAL #10-021 DATED APRIL 15, 2010 WHICH SHOULD BE REMOVED FROM YOUR FILES. THIS REVISION HAS ADDED THE SOLD UNITS. ALL CHANGES ARE HIGHLIGHTED WITH \*\*ASTERISKS\*\*.**

**\*\*NOTE: This Service Action affects both sold and unsold vehicles.\*\***

**NOTE: The VIN List is available on DealerCONNECT for all affected dealers. The VIN List has been inserted in the Service Tab under Rapid Response Transmittals. The dealers receiving the Rapid Response Transmittal Service Action are the "Ship To" dealers and the VIN's listed are specific to their dealership. All involved vehicles will be loaded into the VIP system.**

**NOTE: This should be a top priority and be completed prior to sale to avoid suspect vehicles being delivered to customers.**

**DISCUSSION:**

A number of models built before March 05, 2010 (MDH 0305XX) equipped with a 3.7L engine (Sales code EGK) may have been built with a thermostat that will allow coolant to prematurely pass through. A MIL for P0128 - Thermostat Rationality or P2181 - Cooling System Performance is possible.

Dealers are required to replace the thermostat.

**PARTS REQUIRED:**

(1) 52079476AD Thermostat

**REPAIR PROCEDURE:**

1. Replace the thermostat. Follow the detailed service procedures available in DealerCONNECT/TechCONNECT, Refer To Group 7 – Cooling > Engine > Thermostat removal and installation procedures.

**POLICY:** Reimbursable within the provisions of the warranty.

**TIME ALLOWANCE:**

**LABOR OPERATION NO:**

07-40-01-90 Thermostat, Replace (B)

0.5 Hrs.

**FAILURE CODE:** ZZ – Service Action

If you have any questions, contact your Business Center.