



NUMBER: 23-034-05

GROUP: Body

DATE: July 27, 2005

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of DaimlerChrysler Corporation.

SUBJECT:

Liftgate Secondary Seal - Remove Seal If Loose, Misaligned, Or Wrinkled

OVERVIEW:

This bulletin involves the removal of the liftgate secondary seal.

MODELS:

2005 (WK) Grand Cherokee

NOTE: This bulletin applies to vehicles built prior to February 01, 2005 (MDH 0201XX)

SYMPTOM/CONDITION:

The customer may notice that the liftgate secondary seal is loose, mis-aligned, or distorted. The secondary seal is located along the inner top edge of the liftgate.

Testing has shown that the liftgate secondary seal is not required. The liftgate secondary seal which entered initial vehicle production has been permanently removed from vehicle production.

DIAGNOSIS:

If the customer experiences the above condition perform the Repair Procedure.

PARTS REQUIRED:


Qty.	Part No.	Description
(AR) 1	04897151AB	Brake Parts Cleaner
(AR) 1	04897156AA	Throttle Body Cleaner

NOTE: Do not install a replacement liftgate secondary seal. The seal is no longer required.

REPAIR PROCEDURE:

1. Raise liftgate.
2. Remove the three piece liftgate secondary seal from the liftgate (Fig. 1).

3. Remove the residual seal adhesive. Apply a small amount of an appropriate remover (such as: Throttle Body Cleaner or Brake Parts Cleaner) to the adhesive. Apply adhesive remover carefully. Protect surrounding plastic and other exposed surfaces from the adhesive remover.
4. Close liftgate.

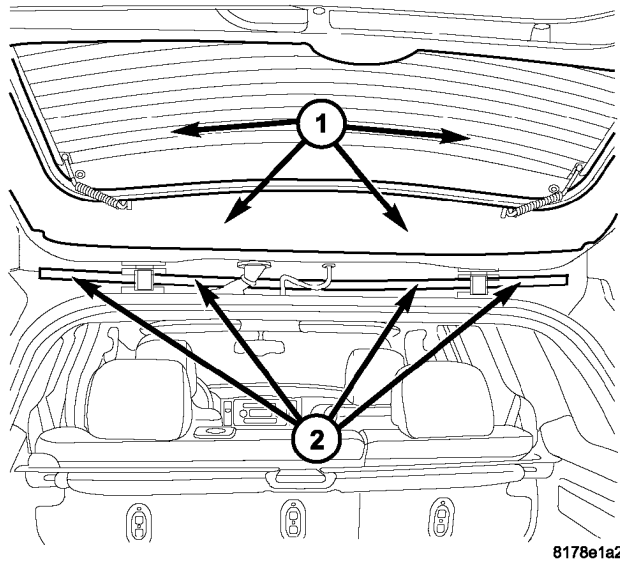

8178e1a2

Fig. 1 LIFTGATE SECONDARY SEAL

- 1 - Liftgate
- 2 - Secondary Seal - Remove (Do Not Replace)

POLICY:
Reimbursable within the provisions of the warranty.

TIME ALLOWANCE:

Labor Operation No:	Description	Amount
23-51-08-96	Seal, Liftgate Secondary - Inspect and Remove	0.5 Hrs.

FAILURE CODE:

XX	Service Adjustment
----	--------------------